



Atwater Park is the only developed park in eastern North Port. One of the park's boundaries is shared with Atwater Elementary School while the rest of the edges are shared with the backyards of single-familyhome lots, many of which are currently undeveloped. This park has many accessible features from grills and tables to the pavilions to companion seating at the ballfields. The main issues at this park are restroom door force is too high and/or closes too quickly and lack of adequate signage for the unisex restrooms.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	None - the picnic shelters provide two picnic tables per location and one is accessible(50%).	<b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 & 1011	<b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.					No Necessary
<b>Men's Restroom - Baseball Fields</b>								

	<p>The men's restroom has a door opening force too high at 14 lbs.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>			
	<p>The men's restroom sink faucet shuts off too quickly at 8 seconds.</p>	<p>ADAAG 606.4</p>	<p>Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs. to operate.</p>	<p>3</p>	<p>2</p>	<p>\$ 625.00</p>			
	<p>The men's restroom stall door is not self closing.</p>	<p>ADAAG 604.8.1.2</p>	<p>Provide the hinges to allow for the stall door to be self-closing.</p>	<p>3</p>	<p>2</p>	<p>\$ 185.00</p>			
<p><b>Women's Restroom - Baseball Fields</b></p>									
	<p>The women's restroom door has an opening force too high at 15 lbs.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>			

	<p>The women's restroom sink faucet shuts off too quickly at 6 seconds.</p>	<p>ADAAG 606.4</p>	<p>Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs. to operate.</p>	<p>3</p>	<p>2</p>	<p>\$ 625.00</p>		
	<p>The women's restroom stall door is not self-closing.</p>	<p>ADAAG 604.8.1.2</p>	<p>Provide the hinges to allow for the stall door to be self-closing.</p>	<p>3</p>	<p>2</p>	<p>\$ 185.00</p>		
<p><b>Splash Pad Unisex Restrooms</b></p>								
	<p>The unisex restroom doors nearest the splash pad have an opening force too high at 15 lbs and closes too quickly at 7 seconds.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>		
	<p>The unisex restroom doors opposite of the splash pad has an opening force too high at 14 lbs and closes too quickly at 6 seconds.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>		



<p>The unisex restroom facing the splash pad does not provide adequate signage.</p>	<p>ADAAG 216.2 &amp; ADAAG 703</p>	<p>The permanent room sign should to be mounted on the wall at the latch side of the door at 48 inches minimum from the baseline of the lowest tactile character to 60 inches maximum from the baseline of the highest character with raised lettering and numbers plus Braille.</p>	<p>4</p>		<p>\$185.00</p>			
 <p>The unisex restroom nearest the splash pad soap dispenser is mounted too high at 50 inches.</p>	<p>ADAAG 308</p>	<p>Relocate the soap dispenser and provide a reach range no higher than 48 inches AFF for a forward reach over an obstruction no deeper than 20 inches or a side reach of 48 inches AFF over an object no deeper than 10 inches.</p>	<p>3</p>	<p>2</p>	<p>\$ 520.00</p>			
<p>The refreshment counter at the splash pad is too high at 37 inches AFF.</p>	<p>ADAAG 904.3.3</p>	<p>Provide a section of counter that is 28 inches to 34 inches AFF and is at least 24 inches long in alterations.</p>	<p>2</p>	<p>4</p>	<p>\$ 670.00</p>			

**Estimated Total Cost for Accessibility Upgrades at Butler Park** \$ 3,415.00

Blue Ridge Park is a neighborhood park located on the western edge of a residential neighborhood along the Blue Ridge Waterway. Most of the park is comprised of forested land with a few active uses including a playground, floating dock, open play area, and a shelter. The main issues at this park are accessible parking, accessible routes, companion seating and the restroom door opening force is too high.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides seven picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

	<p>No accessible route is provided to the pavilion.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p>2</p>	<p>\$ 3,500.00</p>			
	<p>No accessible route is provided to the playground.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>\$ 630.00</p>	<p>4</p>		
	<p>No companion seating is provided to the bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>\$ 315.00</p>		<p>4</p>	
	<p>The grill at the picnic shelter does not provide a route around the grill.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 1011.1</p>	<p><b>Grill Clear Ground Space Recommendation:</b> Provide a 48 inches by 48 inches clear ground space on all usable side of the grill and connected to an accessible route.</p>	<p>2</p>	<p>\$ 520.00</p>			

	<p>No accessible route is provided to the bench for 18 feet.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 630.00</p>		
	<p>The canoe/kayak launch area is very sloped and difficult to get to.</p>	<p>ADAAG 1003</p>	<p>when this canoe/kayak area is scheduled to be updated, relocate the launch area to a more accessible location that includes accessible parking and an accessible route. Until that time advise people on your website and brochures of other accessible canoe/kayak launch sites.</p>	<p>2</p>	<p>4</p>	<p>N/A</p>		
	<p>There is no accessible route to the parking lot.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p>2</p>		<p>\$ 2,800.00</p>		
<p><b>Men's Restroom - Soccer Field</b></p>								

	<p>The men's restroom has a door opening force too high at 18 lbs. and closes too quickly at 3 seconds.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p><b>3</b></p>	<p>2</p>	<p>\$ 105.00</p>		
	<p>The men's restroom sink faucet shuts off too quickly at 2 seconds.</p>	<p>ADAAG 606.4</p>	<p>Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs.</p>	<p><b>3</b></p>	<p>2</p>	<p>\$ 625.00</p>		
	<p>The women's restroom door has an opening force too high at 10 lbs.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p><b>3</b></p>	<p>2</p>	<p>\$ 105.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park**      \$ 10,800.00

Canine Club Park has limited visibility from the street because of its setback from the road and the presence of a landscaped mound that buffers its parking lot. Although there is a sidewalk located across the street from the park, there is no safe pedestrian crossing and no shade trees along neighborhood sidewalks leading to the park. There is no transit access to the park, and signage is limited to identification and regulatory signage. The main issues at this park are no companion seating at the bench, no accesses to and around the drinking fountain, restroom door force is too high, the gate latches are too high and the restroom lock is too high.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>No companion seating is provided to the bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p><b>2</b></p>	<p>4</p>	<p>\$ 315.00</p>		



The drinking fountains is not of an accessible design or a high - low design.

ADAAG 211 & ADAAG 602

Provide two individual drinking fountain or a single Hi-Lo drinking fountain that provides a wheelchair accessible fountain with a spout at 36 inches maximum and a 27 inch minimum knee clearance plus a standing drinking fountain with a height between 38 inches minimum and 43 inches maximum. The toe clearance should be a minimum of 9 inches and the clear floor space should be a minimum of 48 inches long and 30 inches wide centered on the drinking fountain. The water flow should be at least 4 inches high and located within 5 inches from the front of the drinking fountain.

**4**

\$ 4,750.00



The unisex restroom has a door opening force too high at 13lbs and closes too quickly at 4 seconds..

FAC 553.504(6)

Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.

**3**

2 \$ 105.00



Garden of the Five Senses Park is located towards the center of a residential neighborhood, the Garden of the Five Senses is screened by a large black fence and shrubs, limiting visibility into the park. While there is good sidewalk connectivity within the park, there are no sidewalk connections to the surrounding neighborhood. There are also no bus stops or transit routes near the park. Signage includes identification, regulatory, and environmental education signage. The main issues at this park are picnic tables are not accessible, restroom door opening force is too high, faucet shuts off too quickly, the trash cans interfere with the operation of the automatic door opening and there is inadequate space at the restroom door entrances.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelters provides one picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		
<p><b>Men's Restroom</b></p>								

	<p>The men's restroom has a door opening force too high at 10 lbs.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>			
	<p>The men's restroom sink faucet shuts off too quickly at 1 second.</p>	<p>ADAAG 606.4</p>	<p>Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs. to operate.</p>	<p>3</p>	<p>2</p>	<p>\$ 625.00</p>			
<p><b>Women's Restroom</b></p>									
	<p>The women's restroom at the soccer field door has an opening force too high at 10 lbs. and closes too quickly at 3 seconds.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>			

	<p>The automatic door button is blocked by the trash cans in both restrooms.</p>	<p>ADAAG 308</p>	<p>Relocate the trash can to the outside of the restroom to provide a reach range no higher than 48 inches AFF for a forward reach over an obstruction no deeper than 20 inches or a side reach of 48 inches AFF over an object no deeper than 10 inches. The new location should not have the hand dryer protrude into the accessible route.</p>	<p><b>3</b></p>	<p><b>2</b></p>	<p>\$ 520.00</p>		
	<p>Both restroom doors do not have adequate space to open.</p>					<p>\$ 3,500.00</p>		
<p><b>Estimated Total Cost for Accessibility Upgrades at Butler Park</b></p>						<p><b>\$ 6,425.00</b></p>		

Highland Ridge Park is located towards the center of a residential neighborhood in the southwestern portion of the city, Highland Ridge Park is one of the City's best examples of a neighborhood park. It is one of the few parks in the City where residential homes face the park and provide "eyes on the park," and visibility into the park from the surrounding area is excellent. However, there are no sidewalks that directly connect to the park. Signage is limited to identification signage and regulatory signage. The main issues at this park are the lack of accessible picnic tables, no accessible routes to some of the benches, no clear access to the BBQ, there are no protective covers on the sink plumbing and the women's restroom door opening force is too high.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides two picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

	<p>No accessible route is provided to the bench for 18 feet.</p>	<p><u>Proposed</u> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 1,500.00</p>			
	<p>BBQ does not provide adequate clear ground space.</p>	<p><u>Proposed</u> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 750.00</p>			
<b>Men's Restroom</b>									
	<p>The men's restroom has a door opening force too high at 15 lbs.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>			

	<p>The mens restroom sink does not provide pipe protection.</p>	<p>ADAAG 606.5</p>	<p>Provide a protective cover or protective pipe wrapping on the water shut offs and drain pipes.</p>	<p>3</p>	<p>2</p>	<p>\$ 80.00</p>		
<p><b>Women's Restroom</b></p>								
	<p>The women's restroom door has an opening force too high at 14 lbs. and closes too quickly at 4 seconds.</p>	<p>FAC 553.504(6)</p>	<p>Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.</p>	<p>3</p>	<p>2</p>	<p>\$ 105.00</p>		
	<p>The womens restroom sink does not provide pipe protection.</p>	<p>ADAAG 606.5</p>	<p>Provide a protective cover or protective pipe wrapping on the water shut offs and drain pipes.</p>	<p>3</p>	<p>2</p>	<p>\$ 80.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park** **\$ 4,190.00**

Hope Park is located in the center of a residential neighborhood in southwestern North Port. Only one side of the park has views from an adjacent public right-of-way, thereby limiting visibility into the park. While the streets around the park have good sidewalk connectivity, none of the sidewalks connect directly to the park, and there are no shade trees. Signage is limited to identification and regulatory signage. The main issues at this park are no accessible parking or access to park amenities, and the lack of accessible picnic tables.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides two picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

**Two swing benches are provided. Make at least one of them on an accessible route and with a companion seating space.**

	<p>No accessible route is provided to the playground.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 3,500.00</p>		
	<p>No companion seating is provided to the bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 750.00</p>		
	<p>No accessible parking is available.</p>	<p>FAC 553.512</p>	<p>Provide parking spaces on the shortest accessible route to be no steeper than 2% in all directions. The parking space should be a minimum of 12 foot wide and an access aisle a minimum of 5 foot wide. Provide a sign with the International Symbol of Accessibility and at the head and in the middle of the accessible parking space. The sign should be mounted 60 inches AFF and captioned with "Parking By Disabled Permit Only".</p>	<p>1</p>	<p>4</p>	<p>\$ 3,000.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park**

**\$ 8,820.00**

Kirk Park is located at 8305 Trionfo Avenue. It is a small park but includes several nice amenities. It has a nice size pavilion for rentals, playground, basketball court and volleyball court. The main issues at this park are no accessible parking is available, no accessible routes are available for the pavilion, playground, BBQ, swinging bench or courts.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	No accessible parking is available.	FAC 553.512	Provide parking spaces on the shortest accessible route to be no steeper than 2% in all directions. The parking space should be a minimum of 12 foot wide and an access aisle a minimum of 5 foot wide. Provide a sign with the International Symbol of Accessibility and at the head and in the middle of the accessible parking space. The sign should be mounted 60 inches	1	4	\$ 4,000.00		

	<p>The picnic shelter provides four picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p>2</p>	<p>3</p>	<p>\$ 1,570.00</p>		
	<p>No accessible route is provided to the pavilion, BBQ or playground.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p>2</p>	<p>4</p>	<p>\$ 3,500.00</p>		
	<p>No companion seating is provided to the swinging bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 500.00</p>		

---

**Estimated Total Cost for Accessibility Upgrades at Butler Park**

**\$ 9,570.00**

---

LaBrea Park s one of the few parks in the City where residential homes face the park and provide “eyes on the park.” As a result, the park has great visibility from the surrounding area and is one of the few neighborhood parks with vehicular parking along one of the sides of the park. While the streets around the park have good sidewalk connectivity, none of the sidewalks connect directly to the park and there are few shade trees. Signage is limited to identification signage and regulatory signage. The main issues at this park are the lack of accessible picnic tables, no accessible route to the pavillion, playground and benches, and no accessible parking.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides two picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

	<p>No accessible route is provided to the pavilion.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 2,000.00</p>		
	<p>Not adequate clear ground space around the bbq.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p>Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 415.00</p>		
<p><b>Parking</b></p>								
	<p>No accessible parking is available.</p>	<p>FAC 553.512</p>	<p><b>Parking Recommendation:</b> Add at least one ADA parking stall. The parking space should be a minimum of 12 foot wide and an access aisle a minimum of 5 foot wide. Provide a sign with the International Symbol of Accessibility and at the head and in the middle of the accessible parking space. The sign should be mounted 60 inches AFF and captioned with "Parking By Disabled Permit Only".</p>	<p>2</p>		<p>\$ 3,500.00</p>		

	<p>No accessible route is provided to the playground.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p>2</p>	<p>4</p>	<p>\$ 1,500.00</p>		
	<p>No accessible route is provided to the benches.</p>			<p>1</p>	<p>4</p>	<p>\$ 860.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park**

**\$ 9,845.00**

Marina Park is one of two parks with boat ramps in the City of North Port. The park is located deep within a residential neighborhood, requiring boat traffic to reach the park through quiet neighborhood roads. However, its corner site lends itself to excellent visibility from the surrounding area. Sidewalk connectivity is mixed: although there is no direct sidewalk connection to the park, the sidewalk network to the northeast is good. There is no bus stop or transit route near the park, and signage is limited to identification and regulatory signage. The main issues at this park are no accessible picnic tables, no accessible route to the fishing line recycling container.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides two picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		



There is no accessible route to the fishing line disposal container.

ADAAG 1005

Provide an accessible route to the line disposal container.

2

3

\$350.00

**Estimated Total Cost for Accessibility Upgrades at Butler Park**

**\$ 1,920.00**

Marius Park is the smallest neighborhood park, and is located deep in a neighborhood at the end of a residential street. Despite its location, there are “eyes on the park” from homes that face the park, and visibility from the surrounding area is good. The neighborhood has a good network of sidewalks, but they lack shade trees and do not connect directly to the park. The main issues at this park are no access to the picnic tables, benches and the art piece in the park.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	Two picnic tables but none are accessible.	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<b>2</b>	<b>3</b>	\$ 1,570.00		

**Two swing benches are provided. Make at least one of them on an accessible route and with a companion seating space.**

	<p>No accessible parking is provided.</p>	<p>FAC 553.512</p>	<p>Provide an accessible parking space that is a minimum of 12 foot wide and an access aisle a minimum of 5 foot wide. Provide a sign with the International Symbol of Accessibility and at the head and in the middle of the accessible parking space. The sign should be mounted 60 inches AFF and captioned with "Parking By Disabled Permit Only". The parking</p>	<p>1</p>	<p>4</p>	<p>\$ 2,000.00</p>		
	<p>There is not accessible route to the art.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 403 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the accessible picnic table and clear floor space side.</p>	<p>2</p>		<p>\$ 1,200.00</p>		
	<p>No companion seating is provided to the bench and swinging bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 525.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park** **\$ 5,295.00**

# Morgan Family Community Center

Morgan Family Community Center is a community center building that provides parking, fitness center, locker-rooms, gym, restrooms, meeting rooms and kitchen. The main issues at this building are stanchions do not provide a cane detection, tables are not of an accessible design, brochures are mounted too high, door force is too high and/or closes too quickly, paper towel dispenser is mounted too high, coat hooks are mounted too high, an accessible changing bench is not provided, no accessible lockers are provided, no inside handles are provided in the accessible stalls, tampon disposals are mounted too far from the toilet, baby changing tables are mounted too low, mats are too light, bleachers do not provide companion seating, mirror is mounted too high, toilet paper dispenser is not in the proper location, pipe protection is missing, an accessible kitchen sink is not provided, and no accessible kitchen workstation is provided. **Please Note:** When a **UD** is indicated, this is a Universal Design (**UD**) recommendation to enhance accessibility. The **UD** recommendation is not required to meet the minimum accessibility standards but it would be encouraged. If used in the report uses two different accessibility codes. The Americans with Disabilities Act Accessibility Guidelines (ADAAG) can be downloaded from the Access Board website. The website is [www.access-board.gov](http://www.access-board.gov). In addition, the Florida Accessibility Code (FAC) was also used in this report. This code can be downloaded from the website, [www.floridabuilding.org](http://www.floridabuilding.org). The estimated costs for correction of access barriers are taken from the "Means ADA Compliance Pricing Guide 2nd Edition". Each estimated costs for corrective actions have been adjusted for inflation and regional costs to better reflect the 2019 expenses in the North Port area.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information. PLEASE NOTE: Any references for Outdoor Developed Areas is presently not approved by the Department of Justice. However, it would be recommended to follow these standards as "Best Practices" at this point in time. In addition, in existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information. ADAAG 206.2 requires that at least one accessible route be provided within the boundary of the site. The reports provide comments on all routes that when upgrades are made in the future modifications can be made to correct the access barrier or in some cases modify to the greatest extent possible.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The stanchions at the entrance are too high at 37 inches AFF.	ADAAG 307	Provide a cane detectable barrier below 27 inches and the width of the protruding object.	1	1	\$ 625.00			Remove stanchions. These are not a required item for the facility and were placed by staff to help direct patron to the

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The tables near the front entrance are not of an accessible design.	ADAAG 226 & ADAAG 902	Provide at least 5% of the tables but not less than one, with a minimum knee clearance of 27 inches AFF, 17 inches to 25 inches knee and toe clearance and located on the shortest accessible route. <b>UD</b> - Purchase only tables that provide the proper accessibility dimensions.	2	3	\$ 625.00			Look to purchase accessible table.
	The section of counter for a wheelchair user has many items on it.	ADAAG 904.3.3	Clear the lower counter of the various items to keep available for immediate use.	2	1	\$ 55.00			Remove, relocate items from this area. Note there is a wheelchair accessible counter on the opposite end of the front
	The brochures are mounted too high at 58 inches to the top of the rack.	ADAAG 308	Lower the brochure/flyer holder to be at 48 inches AFF. <b>Option:</b> distribute the materials so each type is at a lower height. <b>UD</b> - Mount all brochure racks no higher than 48 inches AFF.	4	1	\$ 105.00			Distribute the materials so each type is at a lower height.
	The other brochures are mounted too high at 53 inches to the top of the rack.	ADAAG 308	Lower the brochure/flyer holder to be at 48 inches AFF. <b>Option:</b> distribute the materials so each type is at a lower height. <b>UD</b> - Mount all brochure racks no higher than 48 inches AFF.	4	1	\$ 105.00			Distribute the materials so each type is at a lower height.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The fitness center door has an opening force too high at 9 lbs. and 11 lbs. and both doors close too quickly at 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 210.00			Submit Work Order for proper adjustments.
	The spacing at the treadmills, elliptical and bikes is too tight.	ADAAG 1004	Relocated this and adjacent machines to provide a minimum 30 inches by 48 inches clear floor space. Provide this at each type of equipment.	2	3	\$ 630.00			Look to adjust layout to accommodate the required space for each type of equipment
	The exit door out of the fitness center closes too quickly at 4 seconds.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.
	The dance door has an opening force too high at 12 lbs.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The paper towel dispenser in the dance room is mounted too high at 61 inches AFF.	ADAAG 308	Remount the paper towel dispenser to provide a reach range no higher than 48 inches AFF to the control for a forward reach over an obstruction no deeper than 20 inches or a side reach of 48 inches AFF over an	4	2	\$ 155.00			Submit Work Order for proper adjustments.
	The exit door from the dance room has an opening force too high at 12 lbs.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.
	The fire alarm pull is mounted too high at 51 inches AFF.	ADAAG 308	Relocate the fire alarm switch to provide a reach range no higher than 48 inches AFF for a forward reach over an obstruction no deeper than 20 inches or a side reach of 48 inches AFF over an object no	2	2	\$ 315.00			Submit Work Order for proper adjustments.
<b>Men's Restroom - Fitness Area</b>									
	The men's restroom at the fitness area door has an opening force too high at 10 lbs.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	3	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The men's restroom at the fitness area has a stall coat hook mounted too high at 51 inches AFF.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.
	The men's fitness center stall door does not provide an inside handle.	ADAAG 604.8.1.2	Provide a door pull complying with ADAAG 404.2.7 on the inside of the door near the latch.	3	2	\$ 105.00			Look to add handle to restroom doors.
	The men's restroom at the fitness area has a coat hook at the showers mounted too high at 61 inches AFF.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.
	The men's restroom at the fitness area does not provide an accessible changing bench.	ADAAG 222 & 903	Provide a bench that is a minimum 42 inches long, and a minimum of 20 inches to a maximum of 24 inches deep. The bench should be affixed to a wall or have a back support that extends at least 42 inches the length of the bench at a point a maximum of 2 inches above the seat. The accessible bench should be adjacent to the accessible lockers and have a seat between 17 inches to 19 inches AFF.	2	3	\$ 800.00			Get quote to move bench against wall.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The men's restroom at the fitness area does not provide accessible lockers.	ADAAG 225.1 & 811	Provide at least 5% of the lockers with accessible locker door hardware. If applicable, provide these at or near the accessible bench.	2	2	\$ 520.00			Look to add an additional shelf in at least 5% of the lockers.
<b>Women's Restroom - Fitness Area</b>									
	The women's restroom at the fitness area has a door opening force too high at 15 lbs.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	3	2	\$ 105.00			Submit Work Order for proper adjustments.
	The women's restroom at the fitness area coat hook in the stall is too high at 51 inches.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.
	The women's fitness center stall door does not provide an inside handle.	ADAAG 604.8.1.2	Provide a door pull complying with ADAAG 404.2.7 on the inside of the door near the latch.	3	2	\$ 105.00			Look to add handle to restroom doors.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The women's restroom at the fitness area coat hook at the shower is too high at 61 1/4 inches AFF.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.
	The women's restroom at the fitness area does not provide an accessible changing bench.	ADAAG 222 & 903	Provide a bench that is a minimum 42 inches long, and a minimum of 20 inches to a maximum of 24 inches deep. The bench should be affixed to a wall or have a back support that extends at least 42 inches the length of the bench at a point a maximum of 2 inches above the seat. The accessible bench should be adjacent to the accessible lockers and have a seat between 17 inches to 19 inches AFF.	2	3	\$ 800.00			Get quote to move bench against wall.
	The women's restroom at the fitness area tampon disposal is too far from the toilet at 32 inches.	ADAAG 308	Relocate the feminine napkin disposal to be no more than 9 inches maximum in front of the toilet if mounted on the sidewall or no more than 20 inches from the toilet if mounted on the back wall. The feminine napkin disposal should be mounted no higher than 48 inches on either	4	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The women's restroom at the fitness area baby changing table is mounted too low at 26 inches AFF.	ADAAG 902	Remount the baby changing table to be no higher than 34 inches AFF to the changing surface and provide a minimum knee clearance of 27 inches. Also mount it so the handle is no higher than 48 inches AFF.	3	2	\$ 285.00			Submit Work Order for proper adjustments.
	The women's restroom at the fitness area does not provide accessible lockers.	ADAAG 225.1 & 811	Provide at least 5% of the lockers with accessible locker door hardware. If applicable, provide these at or near the accessible bench.	2	2	\$ 520.00			Look to add an additional shelf in at least 5% of the lockers.
<b>Gym</b>									
	The gym doors by the fitness area have an opening force too high at 10 lbs. and 11 lbs. and close too quickly at 3 seconds and 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 210.00			Submit Work Order for proper adjustments.
	The emergency door has an opening force too high at 10 lbs.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The double exit doors have an opening force too high at 15 lbs. and 18 lbs.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 210.00			Submit Work Order for proper adjustments.
	The bleachers do not provide companion seating space.	ADAAG 221.2.1 & 802.1	Shift the bleachers to provide the appropriate number of wheelchair spaces (30 inches X 48 inches space) per total number of seats (\$315 per space) with a slope of 2% in all directions. Connect this	2	1	\$ 500.00			Look to adjust layout of bleacher to accommodate the a companion seating area
	The other 3 bleachers do not provide companion seating space.	ADAAG 221.2.1 & 802.1	Shift the bleachers to provide the appropriate number of wheelchair spaces (30 inches X 48 inches space) per total number of seats (\$315 per space) with a slope of 2% in all directions. Connect this	2	1	\$ 500.00			Look to adjust layout of bleacher to accommodate the a companion seating area
	The other set of double doors to the lobby have an opening force too high at 7 lbs. and 9 lbs. and close too quickly at 3 seconds and 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 210.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
<b>Teen Center</b>									
	The two doors into the teen center have an opening force too high at 7 lbs. and close too quickly at 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 210.00			Submit Work Order for proper adjustments.
	The tables in the teen center is not of an accessible design.	ADAAG 226 & ADAAG 902	Provide at least 5% of the tables but not less than one, with a minimum knee clearance of 27 inches AFF, 17 inches to 25 inches knee and toe clearance and located on the shortest accessible route. <b>UD</b> - Purchase only tables that provide the proper accessibility dimensions.	2	1	\$ 625.00			Look to purchase ADA complaint tables

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
<b>Women's Restroom - Near Teen Center</b>									
	The women's restroom near the teen center has a door opening force too high at 25 lbs. and closes too quickly at 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	3	2	\$ 105.00			Submit Work Order for proper adjustments.
	The women's restroom near the teen center coat hook is mounted too high at 53 inches AFF.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The women's restroom near the teen center toilet paper dispenser is mounted to the side.	ADAAG 604.7	Remount the toilet paper dispenser to be no lower than 15 inches, no higher than 48 inches AFF and a centerline of the double roll dispenser that is a minimum of 7 inches to a maximum of 9 inches in front of the toilet. If above the grab bar provide at least 12 inches clearance between the grab bar and the bottom of the toilet paper dispenser. Do not mount the toilet paper dispenser behind the side grab bar. <b>Recommendation:</b> It would be recommend to mount the toilet paper dispenser 1 1/2 inches minimum under the side grab bar and no lower than 15 inches	3	2	\$ 260.00			Submit Work Order for proper adjustments.
	The women's restroom near the teen center tampon disposal is mounted too faraway at 32 inches.	ADAAG 308	Relocate the feminine napkin disposal to be no more than 9 inches maximum in front of the toilet if mounted on the sidewall or no more than 20 inches from the toilet if mounted on the back wall. The feminine napkin disposal should be mounted no higher than 48 inches on either	4	2	\$ 105.00			Submit Work Order for proper adjustments.
	The women's restroom near the teen center stall door does not provide an inside handle.	ADAAG 604.8.1.2	Provide a door pull complying with ADAAG 404.2.7 on the inside of the door near the latch.	3	2	\$ 105.00			Submit Work order to add handle

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
<b>Men's Restroom - Near Teen Center</b>									
	The men's restroom near the teen center door opening force is too high at 26 lbs. and closes too quickly at 3 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	3	2	\$ 105.00			Submit Work Order for proper adjustments.
	The men's restroom near the teen center has a coat hook too high at 53 inches AFF.	ADAAG 308	Lower the existing coat hook or add a second coat hook at 48 inches AFF.	4	2	\$ 55.00			Submit Work Order for proper adjustments.
	The exterior exit door has an opening force too high at 12 lbs. and closes too quickly at 3 seconds.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.
	The wheelchair height drinking fountain is too low at 26 1/8 inch knee clearance.	ADAAG 306 & ADAAG 602.2	Raise the drinking fountain to provide a minimum 27 inches knee clearance and a spout height no higher than 36 inches AFF.	4	2	\$ 1,200.00			Submit Work Order for proper adjustments.
<b>Unisex Restroom - Near Teen Room</b>									

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The unisex restroom near the teen room has a mirror too high at 41 inches AFF.	ADAAG 603.3	Lower the mirror above the sink or countertop to be no higher than 40 inches to the reflective surface. Mirrors not mounted above the sink or a counter top should be mounted no higher than 35 inches to the reflective surface. <b>UD</b> - A full-length mirror would be a recommended	4	2	\$ 520.00			Submit Work Order for proper adjustments.
	The unisex restroom near the teen room has a tampon disposal too far from the toilet at 32 inches.	ADAAG 308	Relocate the feminine napkin disposal to be no more than 9 inches maximum in front of the toilet if mounted on the sidewall or no more than 20 inches from the toilet if mounted on the back wall. The feminine napkin disposal should be mounted no higher than 48 inches on either	4	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The unisex restroom near the teen room toilet paper dispenser is mounted to the side of the toilet.	ADAAG 604.7	Remount the toilet paper dispenser to be no lower than 15 inches, no higher than 48 inches AFF and a centerline of the double roll dispenser that is a minimum of 7 inches to a maximum of 9 inches in front of the toilet. If above the grab bar provide at least 12 inches clearance between the grab bar and the bottom of the toilet paper dispenser. Do not mount the toilet paper dispenser behind the side grab bar. <b>Recommendation:</b> It would be recommend to mount the toilet paper dispenser 1 1/2 inches minimum under the side grab bar and no lower than 15 inches	3	2	\$ 260.00			Submit Work Order for proper adjustments.
	The Arts and Craft Room does not provide pipe protection at the sink.	ADAAG 606.5	Provide a protective cover or protective pipe wrapping on the water shut offs and drain pipes.	3	2	\$ 80.00			Submit Work Order for to cover pipe

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The Meeting Room A has two doors with an door opening force too high at 7 lbs. and 9 lbs. and on door closed too quickly at 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 210.00			Submit Work Order for proper adjustments.
	The double exit door has an opening force too high at 14 lbs. and 23 lbs. and both close too quickly at 3	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 210.00			Submit Work Order for proper adjustments.
<b>The Multi-Purpose Room A</b>									
	The Multi-Purpose Room A hall door has an opening force too high at 7 lbs. and closes too quickly at 4 seconds.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The Multi-Purpose Room A kitchen does not provide an accessible sink.	ADAAG 606	If the kitchen is rented to the public, provide a new sink with a minimum 27 inches knee space, a rim height no higher than 34 inches, clear floor space, pipe wrapping and accessible faucets.	3	1	\$ 3,775.00			Quote for the addition of accessible sink
	The Multi-Purpose Room A kitchen does not provide a work station.	ADAAG 804.3.2	If the kitchen is rented to the public, provide a kitchen counter work surface that is at least 30 inches in length and not higher than 34 inches AFF.	2	1	\$ 725.00			Look to purchase a accessible table that can be stored and used as requested.
	The Multi-Purpose Room A double exit doors near the kitchen have an opening force too high at 14 lbs. and 23 lbs. and both close too quickly at 3 seconds.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.
	The Multi-Purpose Room A double exit doors near the kitchen have a mat too light that could be a tripping hazard.	ADAAG 302.2	Provide a mat with a heavier backing or tape the mat to the floor.	1	2	\$ 155.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The Multi-Purpose Room A double exit doors at the end of the building has an opening force too high at 15 lbs. each and close too quickly at 4 seconds.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 210.00			Submit Work Order for proper adjustments.
	The Multi-Purpose Room A double exit door at the end of the building has a mat too light that could be a	ADAAG 302.2	Provide a mat with a heavier backing or tape the mat to the floor.	1	1	\$ 155.00			Look to replace mat
	The Multi-Purpose Room B hall door near the building exit doors has an opening force too high at 9 lbs.	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 105.00			Submit Work Order for proper adjustments.
	The outside exit door has an opening force to high at 15 lbs. and closes too quickly at 4 seconds.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	1	2	\$ 105.00			Submit Work Order for proper adjustments.

# Morgan Family Community Center

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken	Comments
	The meeting room was busy with a police meeting but it is assumed the door opening force is too high	ADAAG 404.2.8 & ADAAG 404.2.9	Adjust the closer so the door opening force is no heavier than 5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	2	2	\$ 105.00			Submit Work Order for proper adjustments.
<b>Estimated Total Cost for Accessibility Upgrades at Morgan Family Community</b>						<b>\$ 18,405.00</b>			

45 items = \$8380  
9 Items = \$7740  
3 Items = \$2285

Narramore Sports Complex is located on the edge of a few neighborhoods in the eastern part of the city. The park is bordered by the back of residential homes on two sides, Glenallen Elementary School on another side, and a roadway on the fourth side. While the residential homes and elementary school backing onto the park somewhat limit visibility, most of the park has good visibility from the roadway frontage. Additionally, the roads leading up to the park have a good sidewalk network, albeit without shade trees, and provide direct connectivity to the park. The main issues at this park are no accessible routes to the pavilion, fields and team benches. The men's restroom door opening force is too high, the men's and women's sinks turn off too quickly and the coat rack in the women's room is mounted too high.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides four picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

	<p>No accessible route is provided to the fields.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 4,000.00</p>		
	<p>No accessible route is provided to the pavilion.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Recommendation:</b> Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 630.00</p>		
	<p>No accessible route is provided to the team benches.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches. <b>Option:</b> If providing a temporary accessible route, like a Mobi-Mat, place the material done to have a cross slope no steeper than 2%, a running slope no steeper than 5% and connected to an accessible route.</p>	<p>2</p>	<p>4</p>	<p>\$ 5,000.00</p>		

Men's Restroom - Soccer Field								
	The men's restroom has a door opening force too high at 10 lbs.	FAC 553.504(6)	Adjust the closer so the door opening force is no heavier than 8.5 lbs. to open and takes a minimum of 5 seconds to close or provide an automatic door opener at the door.	<b>3</b>	2	\$ 105.00		
	The men's restroom sink faucet shuts off too quickly at 7 seconds.	ADAAG 606.4	Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs. to operate.	<b>3</b>	2	\$ 625.00		
Women's Restroom - Soccer Field								
	The women's restroom sink faucet shuts off too quickly at 7 seconds.	ADAAG 606.4	Provide a lever-operated, push-type or electronically controlled faucet. Self-closing faucets should remain open for at least 10 seconds. Push-type or lever-operated faucets should require not more than 5 lbs. to operate.	<b>3</b>	2	\$ 625.00		



The women's restroom at the soccer field coat hook is mounted too high at 51 inches.

ADAAG 308

Lower the existing coat hook or add a second coat hook at 48 inches AFF.

4

2

\$ 55.00

**Narramore Softball Complex**

**Estimated Total Cost for Accessibility Upgrades at Butler Park \$ 12,610.00**

Pine Park is one of the parks in the City where residential homes face the park and provide “eyes on the park.” This results in excellent visibility from the surrounding area. The park is also one of the few neighborhood parks with parking along one of the sides. While the streets around the park have good sidewalk connectivity, none of the sidewalks connect directly to the park. There are also no shade trees along the sidewalks, and very few in the park itself. The main issues at this park are no accessible picnic tables, no accessible route from the walkway to the playground, no accessible route to the BBQ, and no accessible route to the bench near the volleyball court.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	<p>The picnic shelter provides three picnic tables but none are accessible.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 245 &amp; 1011</p>	<p><b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.</p>	<p><b>2</b></p>	<p><b>3</b></p>	<p>\$ 1,570.00</p>		

	<p>No accessible route is provided to the pavilion.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches and connect to the companion seating of the bench.</p>	<p>2</p>	<p>4</p>	<p>\$ 630.00</p>		
	<p>The grill at the picnic shelter does not provide accessible access.</p>	<p><b>Proposed</b> Outdoor Developed Areas Guidelines ADAAG 1011.1</p>	<p><b>Grill Clear Ground Space Recommendation:</b> Provide a 48 inches by 48 inches clear ground space on all usable side of the grill and connected to an accessible route.</p>	<p>2</p>		<p>\$ 950.00</p>		
	<p>No accessible route is provided to the playground.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p>2</p>		<p>\$ 1,100.00</p>		
	<p>No companion seating is provided to the bench.</p>	<p><b>Proposed</b> Outdoor Areas Standards ADAAG 1011</p>	<p><b>Bench Recommendation:</b> Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.</p>	<p>2</p>	<p>4</p>	<p>\$ 1,000.00</p>		

**Estimated Total Cost for Accessibility Upgrades at Butler Park**

**\$ 5,250.00**

Veterans Park is located on the edge of a residential neighborhood, next to the North Port Public Library. The park has a sidewalk along its perimeter, and a direct sidewalk connection to the neighborhood east of the park. There are no direct sidewalk connections to the neighborhood on the south and west of the park. The main issues at this park are no accessible picnic tables, no close accessible parking and no accessible route to the park from the parking area.

The City of North Port is part of a local government which requires compliance with Title II of the Americans with Disabilities Act (ADA). Changes to the park district would allow for equal opportunity to participate in programs and activities, effective communication, and program accessibility. Access of programs and activities can be achieved by removal of physical barriers, modification of policies, practices and procedures that discriminate against a person with a disability and relocation to an accessibility facility. In existing facilities, the ADA does allow the relocation of a program from an inaccessible facility to an accessible facility until all access barriers have been removed. See 28 C.F.R. §35.150(a)(1);(b)(1) for additional information.

Photo	Barrier	ADAAG/FAC	Solution	Priority	By Whom	Projected Cost	Projected Date	Action Taken
	Two picnic tables but none are accessible.	<u>Proposed</u> Outdoor Developed Areas Guidelines ADAAG 245 & 1011	<b>Picnic Table Recommendation:</b> At least 20% of picnic tables, but no less than two, be of an accessible design, connected to an accessible route. Provide picnic tables that have a clear floor space of 30 inches minimum by 48 inches minimum, a table top between 28 inches minimum of 34 inches maximum and a minimum 27 inches knee clearance. The knee clearance should go 17 inches to 25 inches under the top. Relocate or purchase two accessible picnic tables and locate them on an accessible surface.	<b>2</b>	<b>3</b>	\$ 1,570.00		

	<p>There is no accessible route from parking to the park.</p>	<p>ADAAG 403</p>	<p>Provide a new accessible route with a running slope no steeper than 5% and a cross slope no steeper than 2% and a minimum clear width of 36 inches.</p>	<p><b>2</b></p>	<p>\$ 2,800.00</p>		
	<p>A parking space is provided but not signed and it is not connected to an accessible route that would connect to the trail.</p>	<p>FAC 553.512</p>	<p>Provide an accessible parking space that is a minimum of 12 foot wide and an access aisle a minimum of 5 foot wide. Provide a sign with the International Symbol of Accessibility and at the head and in the middle of the accessible parking space. The sign should be mounted 60 inches AFF and captioned with "Parking By Disabled Permit Only". The parking and access aisle should be no steeper than 2% in all directions. Locate the accessible parking space on the shortest accessible route to the accessible entrance and next to an accessible route with a minimum 44 inches width.</p>	<p><b>1</b></p>	<p>\$ 1,500.00</p>		



No companion seating is provided to the bench.

**Proposed**  
Outdoor  
Areas  
Standards  
ADAAG 1011

**Bench Recommendation:** Provide a clear ground space of at least 30 inches by 48 inches positioned near the bench with one side adjoining the walkway. The clear ground space should have a slope no steeper than 2% in all directions. The clear ground space should not overlap the accessible route or another clear ground space.

**2**

4 \$ 1,000.00

**Estimated Total Cost for Accessibility Upgrades at Butler Park** \$ 6,870.00